


PRECISION CLEAN

MULTI-PURPOSE CLEANER/DEGREASER

A multi-purpose concentrated cleaner/degreaser precisely formulated for industry; removes stubborn soils, greases, oils, sludge, and soot.



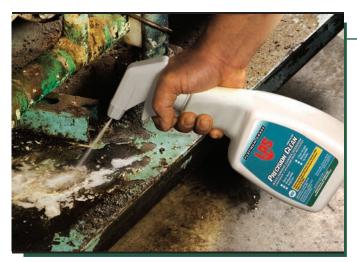











FEATURES

- VOC compliant in all 50 states
- Super industrial strength removes tough stains and soils
- Does not contain butyl, chlorinated or petroleum solvents, bleach, ammonia, or abrasives
- Alkaline formula inhibits flash rusting
- Rinses clean
- Safe on all surfaces except magnesium
- Nonfood Compounds Program Listed Category Code: C1 Registration #059854 (Bulk)



SPECIFICATIONS AND APPROVALS

Approved/Qualified to:

- Tampa Electric Co.
- Halliburton
- Kimberly-Clark
- Inland Steel
- Timken Steel
- Universal-Leaf
- PPG Glass Mfa.
- Kodak
- Hazelton Pump
- Dresser Rand
- Caterpillar
- NSF International

- Honda Corp.
- General Motors Co.
- Ford Motor Co.
- McDonnell Douglas CSD #1
- Lockheed Martin DSDN H01.1578
- FLS Aerospace B757, A32
- British Airways LPSPCCD800
- Boeing D6-17487 Rev. H
- ASTM F-519, Type 1C
- ASTM D-2667
- AMS 1526B
- AMS 1526A

PACKAGE SIZES

Net Contents	Part No.	
READY-TO-USE 18 wt.oz. / 510 g /525 mL aerosol	02720	APPLICATIONS
28 fl.oz. (828 mL) trigger 55 gal. (208 L)	02728 02765	■ Compressors
CONCENTRATE	+ 00701	Engines Floors
1 gal. (3.78 L) 5 gal. (18.93 L) 55 gal. (208 L)	02701 02705 02755	Food processing equipment

Hoists

Lifts

Printing press

Tools



PRECISION CLEAN

MULTI-PURPOSE CLEANER/DEGREASER

PROPERTIES

Appearance/physical state	Clear	Color	Torquise
Odor	Citrus	Flash point °F(°C)	Aerosol: Propellant: -118°C (-180°F) Dispensed liquid: None Ready-to-Use: None Concentrate: None
Boiling point	100°C (212°F)	Flash point method	Tag-closed cup
VOC	Aerosol: 5.8% Ready-to-Use: 0.38% Concentrate: 1.5%	Viscosity	< 3 cSt
Temperature range °F(°C)	32°F - 212°F	Vapor pressure	~ 22mmHg @ 20°C
Solubility in water	100 %	pH:	Aerosol: 12.9 Ready-to-Use: 12.5 Concentrate: 13
HMIS 1996	Aerosol: 1, 3, 0 Ready-to-Use: 1, 0, 0 Concentrate: 1, 0, 0	Type propellant	Aerosol: Hydrocarbon
HMIS III	Aerosol: [/]1, 2, 2 Ready-to-Use: 1, 0, 0 Concentrate: [/]1, 0, 0	NFPA	Aerosol: 1, 3, 0 Ready-to-Use: 1, 0, 0 Concentrate: 1, 0, 0

HANDLING

Use appropriate protective equipment and avoid direct contact with skin. After handling, always wash hands thoroughly with soap and water.

DIRECTIONS

AEROSOL: Shake well before using. Spray on parts and equipment. Wipe with an absorbent cloth for faster drying. To achieve ultralow residue levels, rinse with water. Repeat procedure if necessary for heavy residue. If the product freezes, thaw before use. Test for compatibility on rubber and plastics.

BULK: Apply product to surface then agitate with a brush, cloth or wipe. Remove soils by wiping. Rinse with water for a completely residue free surface.

STORAGE

Keep in original container at ambient temperatures. Do not allow product to freeze. Keep container closed. Keep out of reach of children.

DISPOSAL INFORMATION

Waste must be disposed of in accordance with any and all applicable environmental control rules and/or regulations.

MATERIAL SAFETY DATA SHEETS AVAILABLE UPON REQUEST OR VISIT OUR WEB SITE: WWW.LPSLABS.COM